

Document Information

Location: Body BIW – Opening Roof Systems

Topic: Noise

Condition: Uneven road surface driving

Diagnostic Trouble Codes: N/A

Measure

It has been identified that the convertible roof rollers can produce unwanted noise during normal roof flexing as a result of road anomalies.

Removing the Spider roof rollers and packing them with grease has proven to eliminate such noises.

1. Identify the location of both rollers
2. Locate the securing clip and remove it in order to release the roller pin
3. Place the plastic roller and roller pin on a workbench
4. Thoroughly apply graphite grease on the roller pin and plastic roller
5. Take precaution to protect surrounding surfaces and re-install the roller pin and plastic roller in its original position
6. Ensure that the plastic roller remains saturated with grease after installation
7. Test the roof operation

Use the link in the attachments below for a visual guide of the work that needs to be carried out in order to apply grease on the roof rollers.

Parts Information

N/A

Warranty Information

Resolution Category

Casual Part Number: 11A4041SP

Casual Part Name: RHT-STRIKER SET ROOF COMPLETE

Casual Issue: Noise

Rectification: Repair

Time: 0.5

Attachments

Download file [here](#).

KA Updates Information

N/A

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.