

SERVICE CAMPAIGN BULLETIN


TITLE:	Passenger Footrest Bolts Installation
CAMPAIGN REFERENCE:	03S
DOCUMENT NUMBER:	13 N 001
AFFECTED VEHICLES:	McLaren 570S
SITUATION:	Quality Engineering at McLaren Automotive have identified that a number of McLaren vehicles have left production with two top fixing bolts missing from the passenger footrest.
PROCEDURE:	Please follow the instructions outlined in this document to install the bolts to the passenger footrest.

Removal:


1. Please refer to CA-RM-08001-08-006 - Remove/install footrest - Passenger to access the footrest.

Instructions:

Care Point: Vehicles fitted with satellite tracker module please remove the fixing bolts (1) and lower the module to allow access at the back.

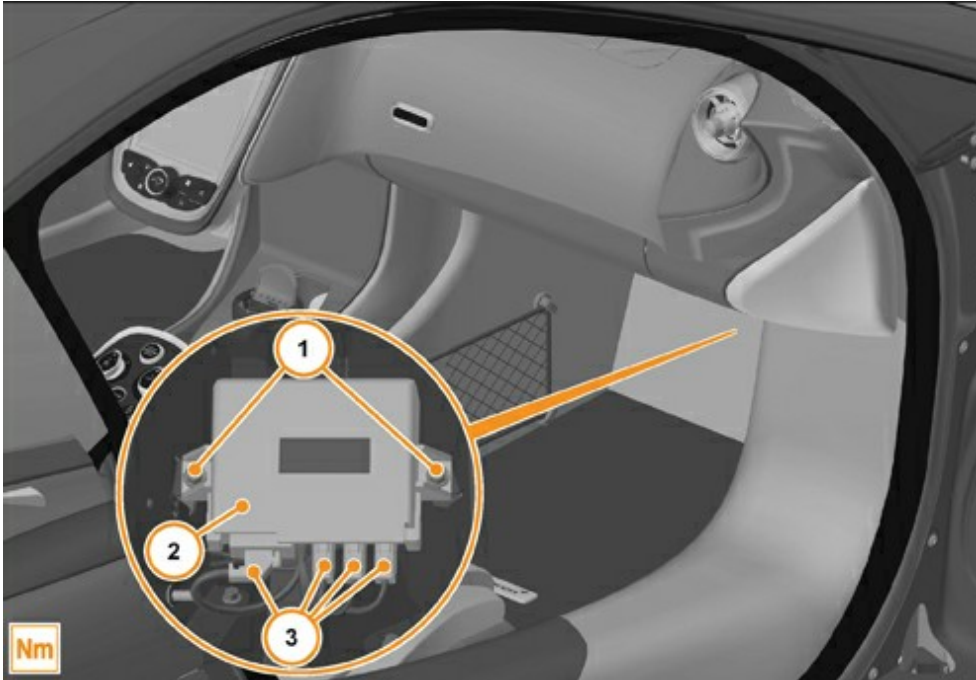

1. Install the two missing fixing bolts (2) and torque to 6 Nm to retain the footrest to the tub.

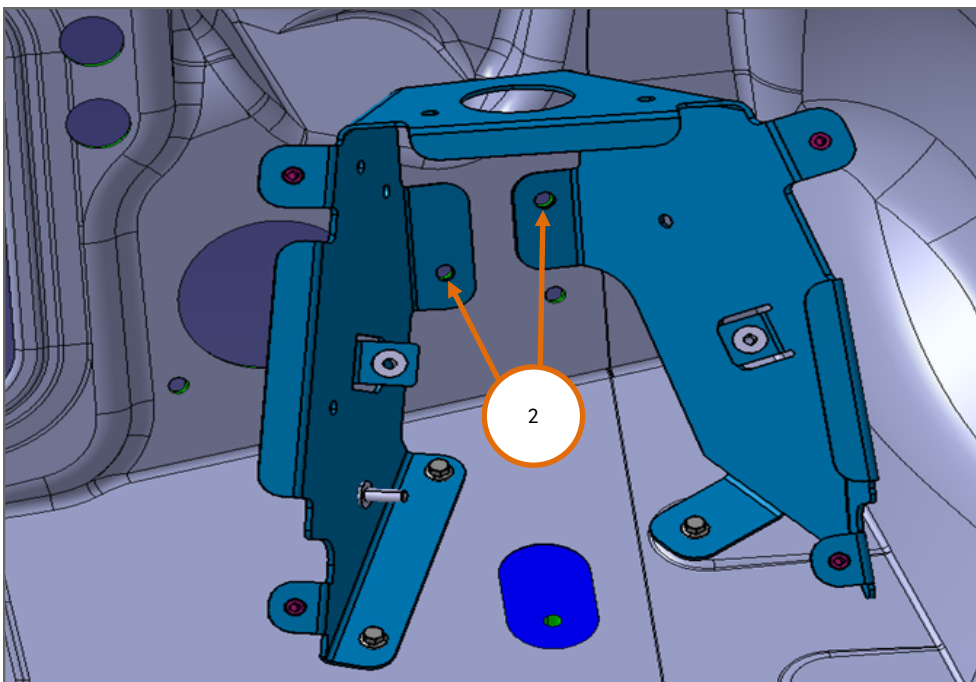

2. Install components in reverse order.

Please contact your Regional Aftersales Manager should you have any questions relating to the information contained within this bulletin.

WARRANTY INFORMATION

DESCRIPTION	RESOLUTION CODE	TOTAL REPAIR TIME
Passenger Footrest Bolts Installation	CHNA0821A11M2J01	0.3 Hours

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY	ORDER PROCESS
Bolt Hex M6	00RA313	2	Unipart